

SK[®] 48-RE


2003-2008 Diesel & V10



2621 Merced Ave El Monte, CA 91733
Product Support 626 443-7451

Corrected Hole Drilling

Valve Body Identification

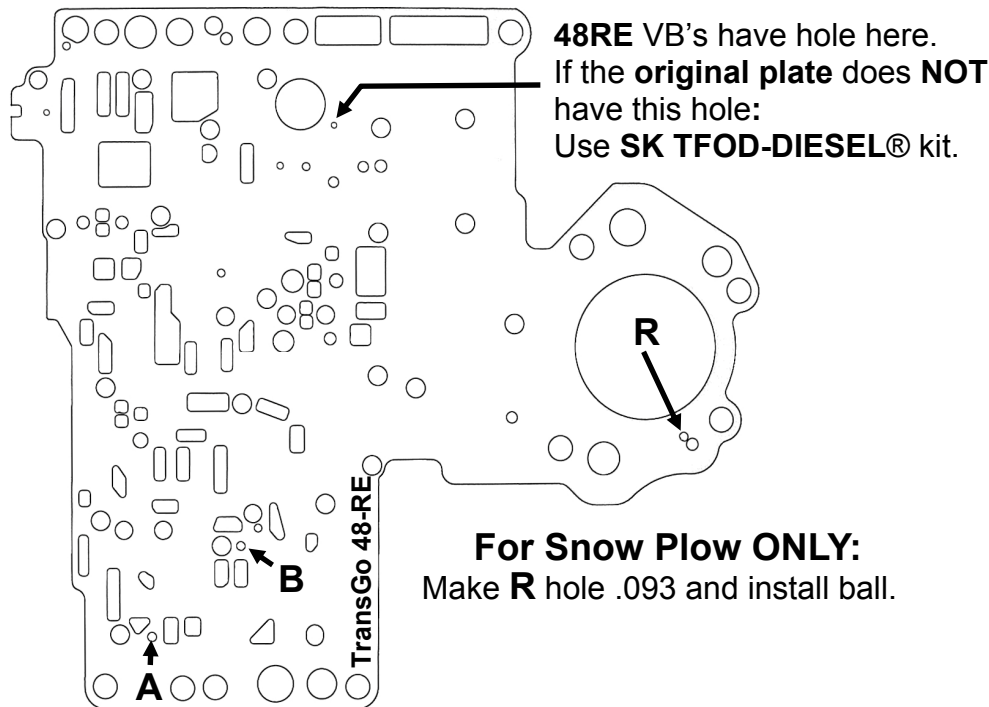

48RE VB's have hole here.
If the **original plate** does **NOT**
have this hole:
Use **SK TFOD-DIESEL[®]** kit.

For Snow Plow ONLY:
Make **R** hole .093 and install ball.

Enlarge holes A & B
with .106 drill. Re-Install
original check balls.

Use this for correct hole locations.
A limited number of kits were released with
hole "B" arrow pointing slightly up and to the
right of its normal location.
We apologize for the error and any
inconvenience this may have caused.

The Tech Team.