

# SK<sup>®</sup> 48-RE


## 2003-2008 Diesel & V10



2621 Merced Ave El Monte, CA 91733  
Product Support 626 443-7451

## Corrected Hole Drilling

### Valve Body Identification

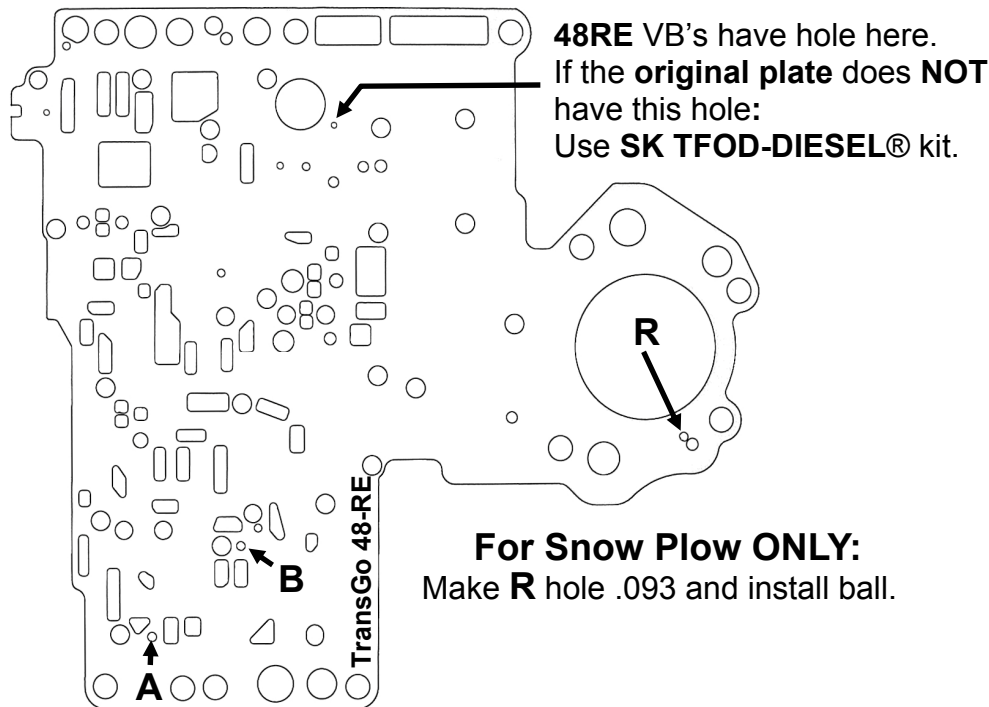

48RE VB's have hole here.  
If the **original plate** does **NOT**  
have this hole:  
Use **SK TFOD-DIESEL<sup>®</sup>** kit.

**For Snow Plow ONLY:**  
Make **R** hole .093 and install ball.

Enlarge holes A & B  
with .106 drill. Re-Install  
original check balls.

**Use this for correct hole locations.**  
A limited number of kits were released with  
hole "B" arrow pointing slightly up and to the  
right of its normal location.  
We apologize for the error and any  
inconvenience this may have caused.

The Tech Team.